



ÚŘAD PRO CIVILNÍ LETECTVÍ
ČESKÁ REPUBLIKA
Sekce technická

letišť Ruzyně, 160 08 Praha 6
tel: 233320922, fax: 220562270

PŘÍKAZ K ZACHOVÁNÍ LETOVÉ ZPŮSOBILOSTI

Číslo: CAA-AD-016/2004

Datum vydání: 11. února 2004

BOEING

737-300, -400, -500

LETOUN - PŘEDNÍ VSTUPNÍ DVEŘE - ZÁCHRANNÉ SKLUZY - KONTROLA/VÝMĚNA

Týká se: letadel Boeing 737-300, -400 a -500, certifikovaných v kterékoliv kategorii, jak je uvedeno v Boeing Special Attention Service Bulletin 737-25-1430, Revize 1, vydaném 10. dubna 2003.

Datum účinnosti: 18. března 2004

Provést v termínech:

Jak je popsáno v FAA AD 2004-02-08, od data účinnosti tohoto PZZ.

Postup provedení prací:

Dle FAA AD 2004-02-08 (příloha tohoto PZZ).

Poznámky:

- Provedení tohoto PZZ musí být zapsáno do letadlové knihy.
- Případné dotazy týkající se tohoto PZZ adresujte na ÚCL sekce technická - Ing. Toman.
- Pokud to vyžaduje povaha tohoto PZZ, musí být zapracován do příslušné části dokumentace pro obsluhu, údržbu a opravy letadla.
- Tento PZZ byl vypracován na základě FAA AD 2004-02-08.

Ing. Pavel MATOUŠEK
ředitel

2004-02-08 Boeing: Amendment 39-13443. Docket 2001-NM-88-AD.

Applicability: Model 737-300, -400, and -500 series airplanes; certificated in any category; as listed in Boeing Special Attention Service Bulletin 737-25-1430, Revision 1, dated April 10, 2003.

Compliance: Required as indicated, unless accomplished previously.

To prevent forward door escape slides from falling out of their compartments into the airplane interior and inflating, which could impede an evacuation in the event of emergency, accomplish the following:

Hinge Assembly Replacement

(a) For airplanes on which the hinge assemblies have not been replaced as of the effective date of this AD in accordance with Boeing Special Attention Service Bulletin 737-25-1430, dated February 22, 2001: Within 36 months after the effective date of this AD, replace the hinge assemblies on the escape slide stowage compartments of the forward doors with new, stronger hinge assemblies, in accordance with Part 1 of the Accomplishment Instructions of Boeing Special Attention Service Bulletin 737-25-1430, Revision 1, dated April 10, 2003.

Hinge Assembly Inspection

(b) For airplanes on which the hinge assemblies were replaced before the effective date of this AD in accordance with Boeing Special Attention Service Bulletin 737-25-1430, dated February 22, 2001: Within 36 months after the effective date of this AD, perform a general visual inspection for incorrectly crimped hinge assemblies, in accordance with Part 2 of the Accomplishment Instructions of Boeing Special Attention Service Bulletin 737-25-1430, Revision 1, dated April 10, 2003. If any hinge assembly is not correctly crimped, perform corrective action before further flight in accordance with Revision 1 of the service bulletin.

Note 1: For the purposes of this AD, a general visual inspection is defined as: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to enhance visual access to all exposed surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

Part Installation

(c) As of the effective date of this AD, when replacing a hinge assembly, no person may install a hinge assembly, part number 65C30431-6 or 65C30431-7, on any airplane.

Alternative Methods of Compliance

(d) In accordance with 14 CFR 39.19, the Manager, Seattle Aircraft Certification Office, FAA, is authorized to approve alternative methods of compliance for this AD.

Incorporation by Reference

(e) The actions shall be done in accordance with Boeing Special Attention Service Bulletin 737-25-1430, Revision 1, dated April 10, 2003. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Effective Date

(f) This amendment becomes effective on March 5, 2004.

Footer Information

Issued in Renton, Washington, on January 20, 2004.

Kalene C. Yanamura,

Acting Manager, Transport Airplane Directorate,
Aircraft Certification Service.

[FR Doc. 04-1914 Filed 1-29-04; 8:45 am]

BILLING CODE 4910-13-P