

PŘÍKAZ K ZACHOVÁNÍ LETOVÉ ZPŮSOBILOSTI

CAA-AD-077/1999R1

Nahrazuje CAA-AD-077/1999

Datum vydání: 17. listopadu 1999

MOTOR - PALIVOVÝ FILTR (ATA 73) - KONTROLA

Týká se: motorů CFM56-3/-3B/-3C všech typů instalovaných na letadlech Boeing 737-300/-400/-500, ale nejen na těchto.

Datum účinnosti: 30. prosince 1999

Provést v termínech: Jak je popsáno v DGAC AD 1999-245(B) R1 (příloha tohoto PZZ).

Postup provedení prací: Dle DGAC AD 1999-245(B) R1.

Poznámky: Provedení tohoto PZZ musí být zapsáno do motorové knihy. Případné dotazy týkající se tohoto PZZ adresujte na ÚCL technický inspektorát - Ing. Toman. Pokud to vyžaduje povaha tohoto PZZ musí být zapracován do příslušné části dokumentace pro obsluhu, údržbu a opravy motoru. Tento PZZ byl vypracován na základě DGAC AD 1999-245(B) R1, který nahrazuje DGAC AD 1999-245(B).

Ing. Pavel MATOUŠEK
Ředitel technického inspektorátu
Úřad pro civilní letectví

DGAC AD ref.: 1999-245(B) R1

CFM INTERNATIONAL

CFM56-3/-3B/-3C Turbofan engines

Inspection of fuel filter cover attachment parts (ATA 73)

1. APPLICABILITY:

This Airworthiness Directive applies to CFMI turbofan engines, CFM56-3/-3B/-3C all types installed on BOEING 737-300/400/-500 or other aeroplanes.

This Airworthiness Directive does not apply to engines which have received Service Bulletin CFM56-3/-3B/-3C 73-A129 dated August 17, 1999.

2. REASON:

The fuel filter cover is maintained with six bolts torqued in helicoll inserts, Loose inserts due to an overtorque led to heavy fuel leakage in flight on one aeroplane.

3. MANDATORY ACTIONS:

3.1. No later than the next A check, perform once all instructions of paragraph 2 of Service Bulletin CFM56-3 No.73-126R1 dated April29, 1999 (or later issue).

For fuel pumps already inspected according to CFMI AOW No. 277/97 of December 12, 1997, there is no need to perform a new inspection.

Note: At every other opening of fuel filter cover, strictly apply AMM procedures.

3.2. No later than Friday, December 31, 2004 or at next shop visit of engine, module or fuel pump whichever occurs first, perform Service Bulletin CFM56-3/-3B/-3C No.73-A129 dated August 17, 1999.

REF.: Service Bulletin CFM56-3/-3B/-3C No.73-126R1 dated April 29, 1999
CFM56-3/-3B/-3C No.73-A129 dated August 17,1999

This Revision 1 replaces original AD 1999-245(B) dated June 16, 1999.

EFFECTIVE DATES:

Original AD : JUNE 26,1999

Revision 1 : DECEMBER 31,1999