

PŘÍKAZ K ZACHOVÁNÍ LETOVÉ ZPŮSOBILOSTI

CAA-AD-094/2000 - oprava

Oprava dle "FAA Correction AD 2000-19-05"

Nahrazuje CAA-AD-038/1999

Datum vydání: 15. listopadu 2000

LETOUN - VÝŠKOVÉ KORMIDLO - KONTROLA

Týká se: letadel Boeing 737-100, -200, -200C, -300, -400 a -500, pořadových čísel na výrobní lince 1 až 2939 včetně, certifikovaných v kterékoliv kategorii.

Datum účinnosti: 28. prosince 2000

Provést v termínech: Jak je popsáno v FAA Correction AD 2000-19-05 (příloha tohoto PZZ).

Postup provedení prací: Dle FAA Correction AD 2000-19-05.

Poznámky: Provedení tohoto PZZ musí být zapsáno do letadlové knihy. Případné dotazy týkající se tohoto PZZ adresujte na ÚCL technický inspektorát - Ing. Toman. Pokud to vyžaduje povaha tohoto PZZ, musí být zapracován do příslušné části dokumentace pro obsluhu, údržbu a opravy letadla. Tento PZZ byl vypracován na základě FAA Correction AD 2000-19-05, který nahrazuje FAA AD 99-05-15.

Ing. Pavel MATOUŠEK
Ředitel technického inspektorátu
Úřad pro civilní letectví

CORRECTION

2000-19-05 BOEING: Amendment 39-11906. Docket 99-NM-69-AD. Supersedes AD 99-05-15, Amendment 39-11063.

Applicability: Model 737-100, -200, -200C, -300, -400, and -500 series airplanes; line numbers 1 through 2939 inclusive; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c)(1) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent detachment of an elevator tab push rod due to a detached nut at either end attachment of a push rod, which could result in excessive high-frequency airframe vibration during flight; consequent structural damage to the elevator tab, elevator, and horizontal stabilizer; and reduced controllability of the airplane; accomplish the following:

RESTATEMENT OF REQUIREMENTS OF AD 99-05-15:

One-Time Inspection

(a) Within 90 days after March 23, 1999 (the effective date of AD 99-05-15, amendment 39-11063): Perform a one-time inspection of all attachment nuts at each end of each elevator tab push rod to measure the run-on torque values of the nuts, in accordance with Boeing Alert Service Bulletin 737-27A1205, dated August 28, 1997.

Corrective Actions

(1) If the run-on torque value of any end attachment nut is within the limits specified in the alert service bulletin, prior to further flight, ensure that the final seating torque of the attachment nuts is within the torque values specified in the alert service bulletin.

(2) If the run-on torque value of any end attachment nut is outside the limits specified in the alert service bulletin, prior to further flight, replace all existing bolts and attachment nuts at each end of each elevator tab push rod with new bolts and self-locking castellated nuts that have cotter pins installed as a secondary locking feature, in accordance with Boeing Service Letter 737-SL-27-118-D, dated December 17, 1999, and ensure that the final seating torque of the nuts is within the torque values specified in the service letter.

Note 2: Accomplishment of the inspection and ensuring adequate final seating torque values prior to the effective date of this AD in accordance with Boeing All-Base Telex M-7272-97-0897, dated February 13, 1997, are considered acceptable for compliance with the actions specified in paragraphs (a) and (a)(1) of this AD for only the forward attachment nuts.

NEW REQUIREMENTS OF THIS AD:

Replacement

(b) Within 24 months or 4,000 flight cycles after the effective date of this AD, whichever occurs first: Replace all existing bolts and attachment nuts at the forward and aft end attachment of each elevator tab push rod with new bolts and self-locking castellated nuts that have cotter pins installed as a secondary locking feature, in accordance with Boeing Service Letter 737-SL-27-118-D, dated December 17, 1999.

Note 3: Replacements accomplished prior to the effective date of this AD in accordance with Boeing Service Letter 737-SL-27-118-A, dated November 14, 1997; 737-SL-27-118-B, dated April 14, 1999; or 737-SL-27-118-C, dated May 19, 1999; are considered acceptable for compliance

with paragraphs (a)(2) and (b) of this AD.

Alternative Methods of Compliance

(c) (1) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Seattle Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Seattle ACO.

(2) Alternative methods of compliance, approved previously in accordance with AD 99-05-15, amendment 39-11063, are considered to be approved as alternative methods of compliance with paragraph (a) of this AD only.

Note 4: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Seattle ACO.

Special Flight Permits

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(e) The actions shall be done in accordance with Boeing Alert Service Bulletin 737-27A1205, dated August 28, 1997, and Boeing Service Letter 737-SL-27-118-D, dated December 17, 1999.

(1) The incorporation by reference of Boeing Service Letter 737-SL-27-118-D, dated December 17, 1999, was approved previously by the Director of the Federal Register as of October 25, 2000 (65 FR 56783, September 20, 2000).

(2) The incorporation by reference of Boeing Alert Service Bulletin 737-27A1205, dated August 28, 1997, was approved previously by the Director of the Federal Register as of March 23, 1999 (64 FR 10935, March 8, 1999).

(3) Copies may be obtained from Boeing Commercial Airplane Group, P.O. Box 3707, Seattle, Washington 98124-2207. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(f) The effective date of this amendment remains October 25, 2000.

FOR FURTHER INFORMATION CONTACT: Scott Fung, Aerospace Engineer, Airframe Branch, ANM-1205, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-1221; fax (425) 227-1181.

Issued in Renton, Washington, on October 24, 2000.

Donald L. Riggin, Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.