

# PŘÍKAZ K ZACHOVÁNÍ LETOVÉ ZPŮSOBILOSTI

**CAA-AD-102/2000**

Datum vydání: 15. listopadu 2000

**LETOUN - LETOVÁ PŘÍRUČKA - ZMĚNA**

**Týká se:** všech letadel ATR 72-101/-102/-201/-202/-211/-212/-212A.

**Datum účinnosti:** 16. listopadu 2000

**Provést v termínech:** Jak je popsáno v DGAC AD 2000-437-052(B) (příloha tohoto PZZ).

**Postup provedení prací:** Dle DGAC AD 2000-437-052(B).

Poznámky: Provedení tohoto PZZ musí být zapsáno do letadlové knihy. Případné dotazy týkající se tohoto PZZ adresujte na ÚCL technický inspektorát - Ing. Stibůrek. Pokud to vyžaduje povaha tohoto PZZ, musí být zapracován do příslušné části dokumentace pro obsluhu, údržbu a opravy letadla. Tento PZZ byl vypracován na základě DGAC AD 2000-437-052(B).

**Ing. Pavel MATOUŠEK**  
**Ředitel technického inspektorátu**  
**Úřad pro civilní letectví**

**DGAC AD No.: 2000-437-052(B)**

AEROSPATIALE MATRA ATR

ATR 72 aircraft

Engines controls-Flight Manual procedure associated with reverse application (ATA 61)

1. APPLICABILITY:

Model ATR 72-101/-102/-201/-202/-211/-212/-212A series aircraft.

2. REASONS:

This Airworthiness Directive (AD) is prompted by a recent event during which an ATR 42-320 swerved off the runway after selection of reverse thrust while the "Low Pitch" condition as defined in the Procedures and Techniques chapter of the FCOM was not effective for both engines.

The actions made mandatory by this AD are intended to prohibit the selection of the reverse position on the engines in the event of propeller thrust dissymmetry.

3. ACTIONS:

Revise the approved Flight Manual (AFM) by incorporating the following change in the 'Normal Procedure' chapter. This can be done by inserting a copy of this AD in the

Flight Manual.

In the Normal Procedures chapter, APPROACH AND LANDING:

**NORMAL LANDING**

Add the following text:

**After nose wheel touch down**

Both PL GI

Both LO PITCH lights Check illuminated

CAUTION: If a thrust dissymmetry occurs or if one LO PITCH light is not illuminated the use of any reverser is not allowed.

Flight Manual revisions Integrating the change described above an being Issued. These approved revisions are considered as mean of ensuring compliance with this AD.

4. COMPLIANCE:

Within 3 days after the effective date of this AD, comply with the instructions of paragraph 3 by inserting a copy of this Airworthiness Directive in the approved Flight Manual.

Incorporate in each Flight Manual, the approved revision introducing the change of the Normal Procedures chapter described in paragraph 3 as soon as receipt of this revision.

REF.: Approved Flight Manuals

EFFECTIVE DATE : OCTOBER 28, 2000