

# PŘÍKAZ K ZACHOVÁNÍ LETOVÉ ZPŮSOBILOSTI

**CAA-AD-136/1999**

Datum vydání: 16. prosince 1999

## LETADLO - ELEKTROINSTALACE - KONTROLA

**Týká se:** letadel SAAB SF 340A výrobních čísel -004 až -159 a 340B výrobních čísel -160 až -459.

**Datum účinnosti:** 27. ledna 2000

**Provést v termínech:** Jak je popsáno v SAD č. 1-149 (příloha tohoto PZZ).

**Postup provedení prací:** Dle SAD č. 1-149.

Poznámky: Provedení tohoto PZZ musí být zapsáno do letadlové knihy. Případné dotazy týkající se tohoto PZZ adresujte na ÚCL technický inspektorát - Ing. Stibůrek. Pokud to vyžaduje povaha tohoto PZZ musí být zapracován do příslušné části dokumentace pro obsluhu, údržbu a opravy letadla. Tento PZZ byl vypracován na základě SAD č. 1-149.

**Ing. Pavel MATOUŠEK**  
Ředitel technického inspektorátu  
Úřad pro civilní letectví

**SAD AIRWORTHINESS DIRECTIVE No.: 1-149**

**AIRCRAFT TYPE: SAAB SF340A and SAAB 340B**

**SERIAL No:s AFFECTED:** SAAB SF340A-004 through-159 a SAAB 340B-160 through-459

**SUBJECT:** Electrical and electronic installations-Inspection of chafing and installation of additional chafe protection on harness routed in the cabin compartment ceiling.

**BACKGROUND:** On one occasion a false tailpipe hot warning occurred due to chafing between a wire and edge string, where wire passes through a frame lightning hole in the cabin ceiling. The same type of chafing was reported from an other A/C during maintenance, with 24545 flight hours. The same type of chafing was also discovered at a similar inspection in an A/C with 17302 flight hours.

The chafing damages can cause false warnings and signal failure.

**REFERENCE DOCUMENTS:** SAAB Aircraft AB Mandatory Service Bulletin, SAAB 340-92-027 dated 10 December, 1999 or later revision.

**ACTIONS:** Perform actions described in SAAB Aircraft AB Mandatory Service Bulletin, SAAB 340-92-027 dated 10 December, 1999 or later

revision.

**COMPLIANCE TIME:** To be performed before 14000 flight hours or within 4000 flight hours after effective date of the SAD, whichever occurs latest.

**EFFECTIVE DATE:** 1999-12-10