

PŘÍKAZ K ZACHOVÁNÍ LETOVÉ ZPŮSOBILOSTI

CAA-AD-056/2002

Datum vydání: 20. května 2002

LETOUN - ZMĚNA LETOVÉ PŘÍRUČKY (AFM)

Týká se: letadel Boeing Model 737-600, -700 a -700C, certifikovaných v kterékoliv kategorii.

Datum účinnosti: 11. července 2002

Provést v termínech: Jak je popsáno v FAA AD 2002-08-52, od data účinnosti tohoto PZZ.

Postup provedení prací: Dle FAA AD 2002-08-52 (příloha tohoto PZZ).

Poznámky: Provedení tohoto PZZ musí být zapsáno do letadlové knihy. Případné dotazy týkající se tohoto PZZ adresujte na ÚCL sekce technická - Ing. Toman. Pokud to vyžaduje povaha tohoto PZZ, musí být zapracován do příslušné části dokumentace pro obsluhu, údržbu a opravy letadla. Tento PZZ byl vypracován na základě FAA AD 2002-08-52.

Ing. Pavel MATOUŠEK
Ředitel sekce technické
Úřad pro civilní letectví

2002-08-52 Boeing: Amendment 39-12727. Docket 2002-NM-109-AD.

Applicability: All Model 737-600, -700, -700C series airplanes, certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To ensure that the flight crew is advised of the potential hazard associated with extending the speedbrakes at speeds in excess of 300 knots indicated airspeed (KIAS), accomplish the following:

Airplane Flight Manual (AFM) Revision

(a) Within 24 clock hours after the effective date of this AD, revise the Limitations Section of the FAA-approved AFM to include the following information. This may be accomplished by inserting a copy of this AD into the Limitations Section of the AFM.

"Do not operate the airplane at speeds in excess of 300 KIAS with speedbrakes extended.

Warning: Use of speedbrakes at speeds in excess of 320 KIAS could result in a severe vibration, which, in turn, could cause extreme damage to the horizontal stabilizer."

Optional Terminating Action

(b) Modification or retrofit of the elevator tab assembly in accordance with a method approved by the Manager, Seattle

Aircraft Certification Office (ACO), FAA, constitutes terminating action for the AFM revision required by paragraph (a) of this AD. Following such modification or retrofit, that AFM revision may be removed from the AFM.

Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Seattle ACO. Operators shall submit their requests through an appropriate FAA Principal Operations or Maintenance Inspector, who may add comments and then send it to the Manager, Seattle ACO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Seattle ACO.

Effective Date

(d) This amendment becomes effective on May 1, 2002, to all persons except those persons to whom it was made immediately effective by emergency 2002-08-52, issued on April 11, 2002, which contained the requirements of this amendment.