



CIVIL AVIATION AUTHORITY
CZECH REPUBLIC
Airworthiness Division

Airport Ruzyně, 160 08 Prague 6
tel: +420 233 320 922, fax: +420 220 562 270

AIRWORTHINESS DIRECTIVE

Number: CAA-AD-001/2005
Date of issue: January 17, 2005
AEROTECHNIK Kunovice
L-60S.607-00

PROPELLER – PROPELLER HUB - INSPECTION

Applicability: to propellers L-60S.607-00 type all serial numbers, produced by AERON Brno.

Reason: possibility of cracks appearance and disconnection of the wood ply in the center hole of propeller.

Effective date: February 18, 2005.

Compliance: Before the further flight.

Perform the inspection of the propeller at the L-60S airplane approved service center.

The approved service center shall elaborate after the inspection an inspection report and send this report to address:

CAA CZ
Airworthiness division, Powerplant section,
Airport Ruzyně
160 08 Prague 6

It is necessary to clean the center hole of the propeller to the pure wood by the abrasive cloth. Any cracks appearance must not be detected and/or disconnection of the wood ply.

In the case of the cracks appearance finding and/or disconnection of the wood ply in the center hole, the repair is not possible. The propeller must be remove of the service.

Remarks: The compliance of this AD must be recorded in Aircraft Logbook, where applicable the requirements of this AD must be integrated into Aircraft Technical Documentation. Address inquiries concerning this AD to: Civil Aviation Authority-CZ, Airworthiness Division, Ruzyně Airport, 160 08 Prague 6, Czech Republic, tel.: + 420 233 320 922, fax: +420 220 562 270.



Ing. Pavel MATOUŠEK
Director