

[Federal Register, Volume 87 Number 245 (Thursday, December 22, 2022)]
[Rules and Regulations]
[Pages 78532-78535]
From the Federal Register Online via the Government Publishing Office [www.gpo.gov]
[FR Doc No: 2022-27670]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-1239; Project Identifier MCAI-2022-00301-E; Amendment 39-22279; AD 2022-26-01]

RIN 2120-AA64

Airworthiness Directives; GE Aviation Czech s.r.o. (Type Certificate Previously Held by WALTER Engines a.s., Walter a.s., and MOTORLET a.s.) Turboprop Engines

AGENCY:

Federal Aviation Administration (FAA), DOT.

ACTION:

Final rule.

SUMMARY:

The FAA is adopting a new airworthiness directive (AD) for certain GE Aviation Czech s.r.o. (GEAC) M601D-11, M601E-11, M601E-11A, M601E-11AS, M601E-11S, M601F, H75-100, H75-200, H80, H80-100, H80-200, H85-100, and H85-200 model turboprop engines. This AD was prompted by reports of cracks in dilution tube weld areas of the combustion chamber outer liner. This AD requires initial and repetitive borescope inspections (BSIs) of the dilution tube weld areas of the combustion chamber outer liner and, depending on the results of the inspections, replacement of the combustion chamber outer liner with a part eligible for installation. The FAA is issuing this AD to address the unsafe condition on these products.

DATES:

This AD is effective January 26, 2023.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of January 26, 2023.

ADDRESSES:

AD Docket: You may examine the AD docket at *regulations.gov* under Docket No. FAA-2022-1239; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For GEAC service information identified in this final rule, contact GE Aviation Czech s.r.o., Beranovych 65, 199 02 Praha 9, Letňany, Czech Republic; phone: +420 222 538 111.
- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (817) 222-5110. It is also available at *regulations.gov* under Docket No. FAA-2022-1239.

FOR FURTHER INFORMATION CONTACT:

Barbara Caufield, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: (781) 238-7146; email: barbara.caufield@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend [14 CFR part 39](#) by adding an AD that would apply to certain GEAC M601D-11, M601E-11, M601E-11A, M601E-11AS, M601E-11S, M601F, H75-100, H75-200, H80, H80-100, H80-200, H85-100, and H85 200 model turboprop engines. The NPRM published in the **Federal Register** on September 27, 2022 ([87 FR 58466](#)). The NPRM was prompted by AD 2022-0034, dated March 4, 2022, issued by the European Union Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union (referred to after this as “the MCAI”). The MCAI states that occurrences of cracks in dilution tube weld areas of the combustion chamber outer liner have been reported. These cracks can lead to crack propagation, possibly resulting in part separation, loss of engine power, and reduced control of the aircraft.

In the NPRM, the FAA proposed to require initial and repetitive BSIs of the dilution tube weld areas of the combustion chamber outer liner and, depending on the results of the inspections, corrective action in accordance with the service information. The FAA is issuing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA-2022-1239.

Discussion of Final Airworthiness Directive

Comments

The FAA received no comments on the NPRM or on the determination of the costs.

Conclusion

These products have been approved by the aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA reviewed the relevant data and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products. Except for minor editorial changes, this AD is adopted as proposed in the NPRM.

Related Service Information Under [1 CFR Part 51](#)

The FAA reviewed GEAC Alert Service Bulletin (ASB) ASB-H75-72-40-00-0056 [01], ASB-M601E-72-40-00-0113 [01], ASB-H80-72-40-00-0099 [01], ASB-M601D-72-40-00-0081 [01], ASB-M601F-72-40-00-0064 [01], ASB-M601Z-72-40-00-0063 [01], and ASB-H85-72-40-00-0045 [01], (single document; formatted as service bulletin identifier [revision number]), dated February 16, 2022. This service information specifies procedures for BSIs of the dilution tube weld areas of the combustion chamber outer liner and replacement of the combustion chamber outer liner.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES** .

Costs of Compliance

The FAA estimates that this AD affects 33 engines installed on airplanes of U.S. registry.

The FAA estimates the following costs to comply with this AD:

Estimated Costs

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
BSI of combustion chamber outer liner	2.5 work-hours × \$85 per hour = \$212.50	\$0	\$212.50	\$7,012.50

The FAA estimates the following costs to do any necessary replacements that would be required based on the results of the inspection. The agency has no way of determining the number of aircraft that might need these replacements:

On-Condition Costs

Action	Labor cost	Parts cost	Cost per product
--------	------------	------------	------------------

Action	Labor cost	Parts cost	Cost per product
On-wing replacement of combustion chamber outer liner	64 work-hours × \$85 per hour = \$5,440	\$74,909	\$80,349
In-shop replacement of combustion chamber outer liner	56 work-hours × \$85 per hour = \$4,760	74,909	79,669

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected operators.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under [Executive Order 13132](#). This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in [14 CFR Part 39](#)

- Air transportation
- Aircraft
- Aviation safety
- Incorporation by reference
- Safety

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends [14 CFR part 39](#) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: [49 U.S.C. 106\(g\)](#), [40113](#), [44701](#).

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2022-26-01 GE Aviation Czech s.r.o (Type Certificate previously held by WALTER Engines a.s., Walter a.s., and MOTORLET a.s.): Amendment 39-22279; Docket No. FAA-2022-1239; Project Identifier MCAI-2022-00301-E.

(a) Effective Date

This airworthiness directive (AD) is effective January 26, 2023.

(b) Affected ADs

None.

(c) Applicability

This AD applies to GE Aviation Czech s.r.o. (GEAC) M601D-11, M601E-11, M601E-11A, M601E-11AS, M601E-11S, M601F, H75-100, H75-200, H80, H80-100, H80-200, H85-100, and H85-200 model turboprop engines installed on single-engine airplanes, with an installed combustion chamber outer liner having part numbers (P/Ns) M601-229.3, M601-229.3A, M601-229.3B, M601-229.31A, or M601-229.31B.

(d) Subject

Joint Aircraft System Component (JASC) Code 7240, Turbine Engine Combustion Section.

(e) Unsafe Condition

This AD was prompted by reports of cracks in dilution tube weld areas of the combustion chamber outer liner. The FAA is issuing this AD to prevent failure of the combustion chamber outer liner. The unsafe condition, if not addressed, could result in uncontained release of the combustion chamber outer liner, loss of engine power, and reduced control of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

(1) At the next 300-hour (Type 3) engine inspection, or within 25 flight hours (FHs) after the effective date of this AD, whichever occurs later, and thereafter at intervals not to exceed 300 FHs, perform a borescope inspection (BSI) of the dilution tube weld areas of the combustion chamber outer liner in accordance with the Accomplishment Instructions, paragraph 2.1 of GEAC Alert Service Bulletin (ASB) ASB-H75-72-40-00-0056 [01], ASB-M601E-72-40-00-0113 [01], ASB-H80-72-40-00-0099 [01], ASB-M601D-72-40-00-0081 [01], ASB-M601F-72-40-00-0064 [01], ASB-M601Z-72-40-00-0063 [01], and ASB-H85-72-40-00-0045 [01] (single document; formatted as service bulletin identifier [revision number]), dated February 16, 2022 (the ASB).

(2) If a crack is detected during any BSI required by paragraph (g)(1) of this AD, before further flight, perform the applicable corrective actions in accordance with the Accomplishment Instructions, paragraph 2.1, Table 1 of the ASB.

(h) Terminating Action

Replacing the affected combustion chamber outer liner with a combustion chamber outer liner that does not have P/N M601-229.3, M601-229.3A, M601-229.3B, M601-229.31A, or M601-229.31B, constitutes a terminating action for the repetitive inspections required by paragraph (g)(1) of this AD.

(i) Conditional Part Installation

(1) After the effective date of this AD, it is permissible to install an engine, having an affected combustion chamber outer liner installed, on a single-engine airplane, provided that prior to operation, the BSI required by paragraph (g)(1) of this AD is performed and, depending on the findings, the applicable corrective actions are performed as required by paragraph (g)(2) of this AD.

(2) After the effective date of this AD, it is permissible to install an affected combustion chamber outer liner on the engine of a single-engine airplane, provided that it is a part eligible for installation, as defined in paragraph (j) of this AD, and provided that prior to operation, the BSI required by paragraph (g)(1) of this AD is performed and, depending on the findings, the applicable corrective actions are performed as required by paragraph (g)(2) of this AD.

(j) Definitions

For the purpose of this AD, a “part eligible for installation” is an affected combustion chamber outer liner, which was not previously installed on an engine, or an affected combustion chamber outer liner that, before installation, has passed an inspection (no defects found) in accordance with the Accomplishment Instructions, paragraphs 2.2 and 2.3 of the ASB, or a combustion chamber outer liner that does not have P/Ns M601-229.3, M601-229.3A, M601-229.3B, M601-229.31A, or M601-229.31B.

(k) Alternative Methods of Compliance (AMOCs)

The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in § 39.19. In accordance with § 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to

the manager of the certification office, send it to the attention of the person identified in paragraph (l) (2) of this AD or email to: ANE-AD-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(l) Additional Information

(1) Refer to European Union Aviation Safety Agency (EASA) AD 2022-0034, dated March 4, 2022, for related information. This EASA AD may be found in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2022-1239.

(2) For more information about this AD, contact Barbara Caufield, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: (781) 238-7146; email: barbara.caufield@faa.gov.

(m) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under [5 U.S.C. 552\(a\)](#) and [1 CFR part 51](#).

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) GE Aviation Czech s.r.o. (GEAC) Alert Service Bulletin (ASB) ASB-H75-72-40-00-0056 [01], ASB-M601E-72-40-00-0113 [01], ASB-H80-72-40-00-0099 [01], ASB-M601D-72-40-00-0081 [01], ASB-M601F-72-40-00-0064 [01], ASB-M601Z-72-40-00-0063 [01], and ASB-H85-72-40-00-0045 [01] (single document; formatted as service bulletin identifier [revision number]), dated February 16, 2022.

(ii) [Reserved]

(3) For GEAC service information identified in this AD, contact GE Aviation Czech s.r.o., Beranových 65, 199 02 Praha 9, Letňany, Czech Republic; phone: +420 222 538 111.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (817) 222-5110.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on December 7, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[[FR Doc. 2022-27670](#) Filed 12-21-22; 8:45 am]

BILLING CODE 4910-13-P